

# Stay in the Dark

**Y**ou can search TM 11-5805-778-24P-1/2 until the cows come home, but you won't find any blackout curtains for your AN/TTC-39D telephone central.

Order the right-side curtain with NSN 7230-00-792-6339 and the left-side curtain with NSN 7230-00-792-6341.


Here's the hardware you need to get the curtains up:



Some of the parts you need have no NSNs. So order them by part number on DD Form 1348-6 from RIC B16:

Part	Item	Part Number
Blind rivet nut	1	5310-00-068-0221
Chain hook	4	4030-01-022-5465
Strap assembly	7	5342-01-022-5190
Drapery hook	9	7230-01-028-0884
Screw	16	5305-00-059-3661
Lock washer	17	5310-00-933-8120
Flat washer	18	5310-00-619-1145
Screw	19	5305-00-054-6671
Flat washer	20	5310-00-880-5978
Bolt	21	5306-00-543-4405
Lock washer	22	5310-00-974-6623
Flat washer	23	5310-01-389-6965
Screw	24	5305-00-059-3660
Nut	25	5310-00-934-9765
Screw	26	5305-00-051-0840
Screw	27	5305-00-054-6670
Screw	28	5305-00-051-0836

Part	Item	Part Number
Shim	2	SM-B-835739-2
Double-angle bracket	3	SM-D-811974
Mounting bracket	6	SM-C-821878
Mounting bracket	8	SM-D-812879
Structural section	10	SM-D-811973
Mounting bracket	11	SM-D-811972
Metal strip	12	SM-B-744780
Metal strip	14	SM-B-835740
Angle bracket	15	SM-D-812880

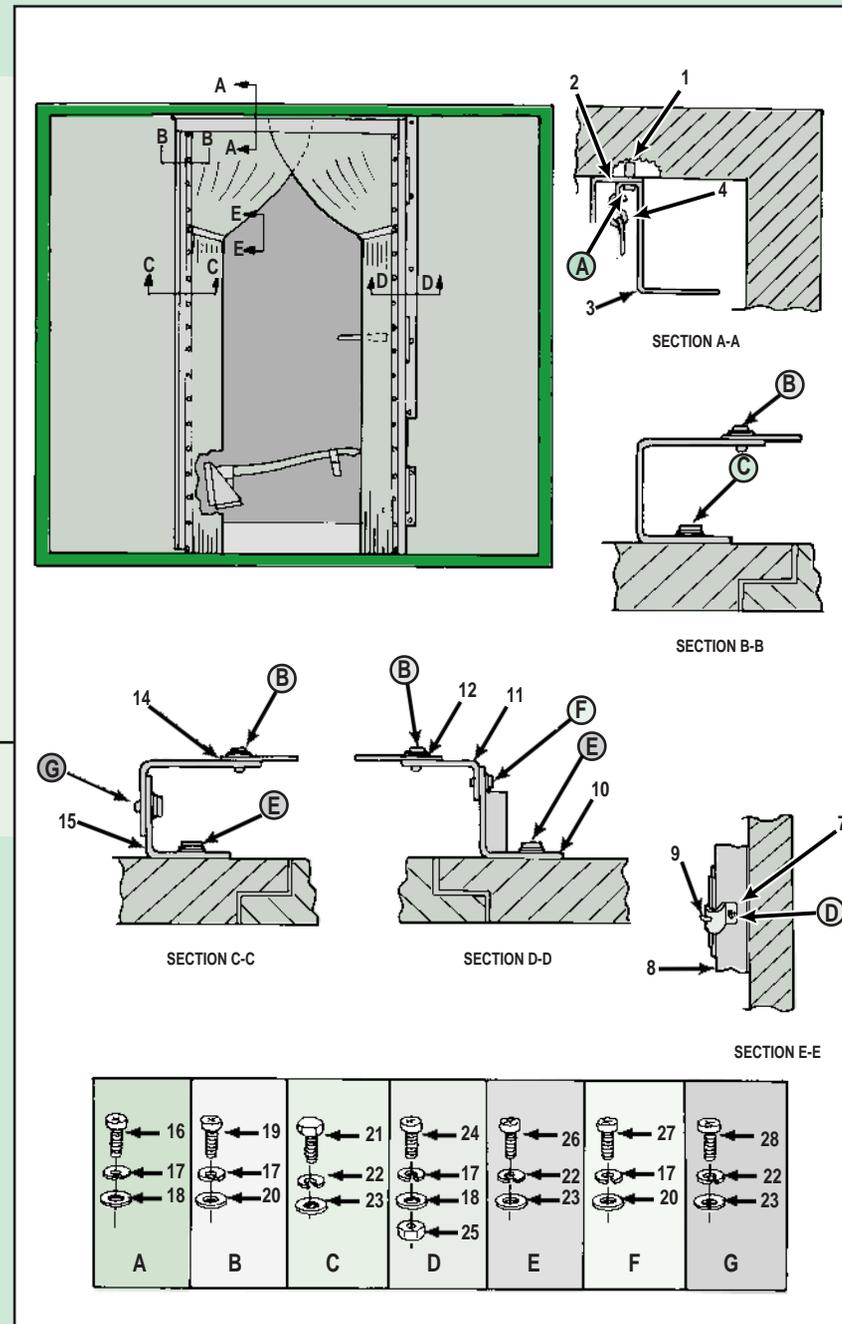

# *An Able Cable*

**T**he J-6362/U 24-volt vehicular cable, NSN 5940-01-427-9395, lets you operate the PP-8444A/U portable battery charger from a vehicle's NATO slave receptacle.

But sometimes you plug the cable up and get nothing. Before you trash the cable, check the AC and DC power switches on the charger. Make sure the AC power switch is OFF and the DC switch ON.

If the DC is on and you're still not getting power, turn the switch on and off several times to help clean the contacts.

Still nothing? If you have compressed air, like the canned air used for cleaning keyboards, use it to clean the contacts.

*Still* nothing? Make sure both ends of the cable are clean by removing them, cleaning away any debris and wiping off the contacts. Then reseal them.

If you're still not getting 24 volts of power to your charger, troubleshoot the charger to find out if the cable or the charger is the problem. Troubleshooting procedures are in Para 4-2 of TM 11-6130-489-13&P.



NATO  
slave  
cable

PP-  
8444A/U  
portable  
battery  
charger